


Installation instructions for Set # 3.1129

Transmission Mount


ENERGY SUSPENSION
1131 VIA CALLEJON, SAN CLEMENTE, CA 92673

17P17701
10/3/2019 JGG

15.08.72.39 plate must be used.
(It is not a spacer)

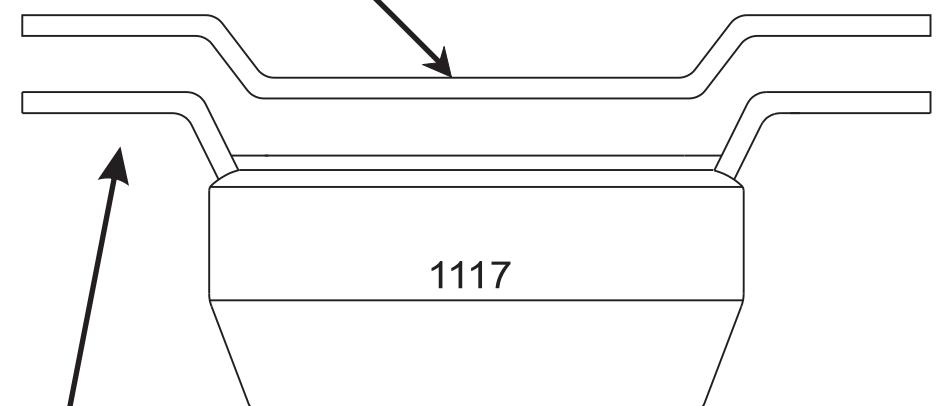

Must reuse
factory fasteners
at this position

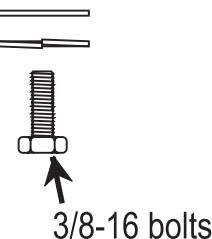


3/8-16 bolts


Supplied flat
washers,
lockwashers
and 2 new
bolts

Tighten all fasteners to factory specifications

© 2017 Energy Suspension. All rights reserved.
May not be reproduced, in any form, or by any means,
without the written consent of Energy Suspension.

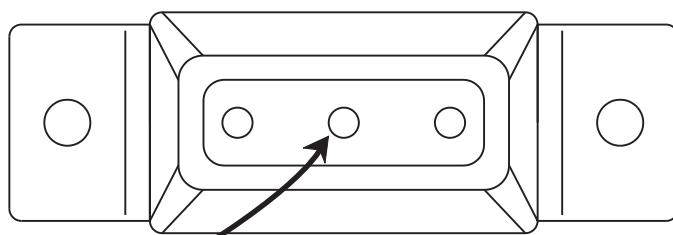


This hole is not used. (Center hole is for manufacturing purposes.)

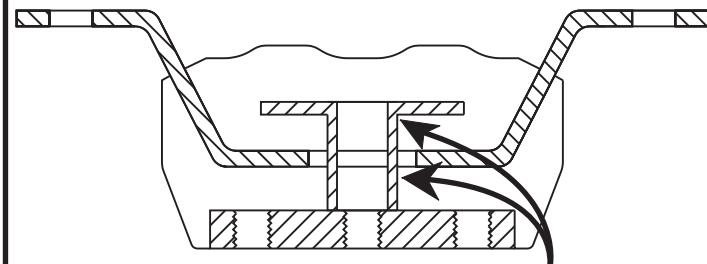

Side view (cutaway) showing safety interlock

Crossmember center section diagram

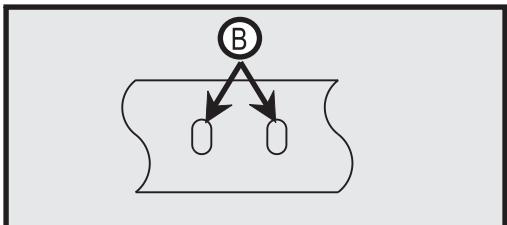

Before installing the new mount, be sure to check the transmission crossmember for cracks or damage at the slotted hole areas. On some vehicles, because of the nuts used on the factory studs, it will be necessary to clean out the slots with a file for clearance when using the new bolts. Repair or replace the crossmember if any damage is evident. On high performance (race condition) applications, reinforcing the area around the mounting point of the crossmember is recommended. This type of crossmember had an inherent problem with stress cracks around the bolt holes. Always check the front engine mounts and replace if necessary.